

Responsible: Uwe Laarmann

Telefon: +49 209 401-732

Date: 10.10.2019

Fax: +49 209 401-743



Changing the side grid and the nuts

Models affected

CBM 6330.0

CM 6330.0

CBM 6550.0

CBM 6350.0

Production until march März 2018 and until serial number TP182*


Description

On appliances before TP182, the two side grids and the corresponding fixing nuts - if not already done - must be replaced.

! This will prevent damage to the enamel!

The lateral grid Nuts support produced in stainless steel can be identified by visual inspection since the design is distinct from the chromed nuts, as following:

Chromed support nuts (it can be easily identified by the knurl of the nut)

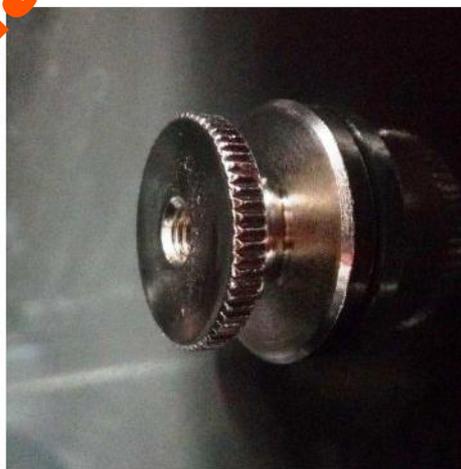


Stainless steel support nuts (two versions available/without and with groove)




For the lateral grid inspection the following aspects must be confirmed by visual inspection:

OK: round edges

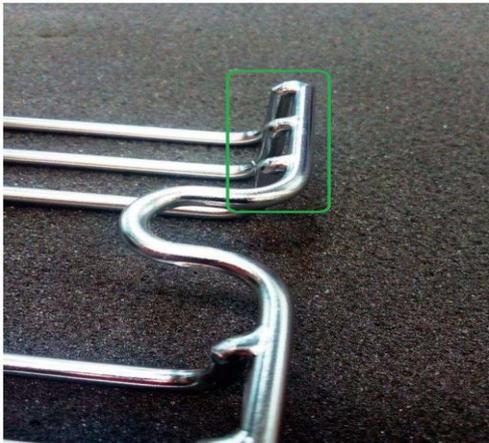

not OK: sharp edges

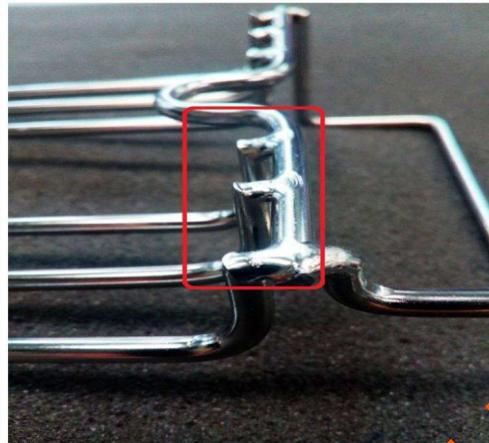

OK: flat surface in contact with the cavity



not OK: sharp projections



The side rails must be firmly screwed in with the lock nuts, otherwise they could damage and/or overheat.



When warming up small containers, such as a glass of water, milk or a small pack of popcorn, you will achieve the best results

- if you place the container on the glass tray, the rectangular tray as far down as possible
- turn or stir the food at regular intervals to improve heating uniformity

As a general rule, the best heat results are achieved in the microwave if the container is placed as low as possible on either a glass tray or a rectangular tray.

Spare parts numbers

547891 Side grid right MW / FV MMX
 547892 Side grid right MW / FV MMX
 547890 Nut MMX.